• EXHAUST SYSTEM—LOOSE CATALYST OR MUFFLER HEAT SHIELDS

• NOISE—"BUZZING" OR "RATTLING"—LOOSE CATALYST OR MUFFLER HEAT SHIELDS

Article No. 98-20-10

FORD: 1993 FESTIVA

1993-1994 TEMPO

1993-1997 PROBE, THUNDERBIRD

1993-1999 CROWN VICTORIA, ESCORT, MUSTANG, TAURUS

1994-1997 ASPIRE 1995-1999 CONTOUR 1993-1996 BRONCO

1993-1997 AEROSTAR, F SUPER DUTY, F-350

1993-1999 ECONOLINE, EXPLORER, F-150, F-250 LD, RANGER

1995-1999 WINDSTAR 1997-1999 EXPEDITION

1999 F-250 HD, SUPER DUTY F SERIES

LINCOLN: 1993-1999 CONTINENTAL, TOWN CAR

1998-1999 NAVIGATOR

MERCURY: 1993-1994 CAPRI, TOPAZ

1993-1997 COUGAR

1993-1999 GRAND MARQUIS, SABLE, TRACER

1995-1999 MYSTIQUE

1999 COUGAR

1997-1999 MOUNTAINEER, VILLAGER

This TSB article is being republished in its entirety to include additional vehicles and to include 1999 model year vehicles.

ISSUE

A "buzzing" or "rattling" noise from the exhaust system may be caused by a loose heat shield attachment to the catalytic converter, catalytic pipes, muffler pipes and/or muffler. The noise is noticeable during normal driving conditions or at engine idle.

ACTION

Install worm clamps to secure loose heat shield attachments. Refer to the following Service Procedure for details.

SERVICE PROCEDURE

 Inspect for loose shields. If shield(s) is missing, this TSB does not apply. Refer to the appropriate Service or Workshop Manual for repair procedures.

NOTE

UNDER NO CIRCUMSTANCES SHOULD A HEAT SHIELD BE REMOVED WITHOUT REPLACEMENT BEFORE THE VEHICLE IS RETURNED TO THE CUSTOMER.

- Install worm clamps to the catalytic converter, catalytic pipes, muffler pipes or muffler as shown in Figure 1 for the typical light truck and Figure 2 for the typical passenger car.
- 3. Align the clamps to secure the heat shield to the catalytic converter, catalytic pipes, muffler pipes or muffler as required.
- 4. Tighten the clamps to 6.8 Nem (60 lb-in).
- 5. Trim the excess "ear" of the clamp to approximately 2.54 cm (1").

Article No. 98-20-10 Cont'd.

PART NUMBER	PART NAME
FOTZ-5A231-A W705949-S300	Worm Clamp (4-1/2" To 9-1/2") Worm Clamp (3/4" To 4")

OTHER APPLICABLE ARTICLES: NONE

SUPERSEDES: 98-6-4

WARRANTY STATUS: Eligible Under Basic

Warranty Coverage For 1991 And Prior Models, Bumper To Bumper Warranty Coverage For 1992-99 Models, And Any Applicable Emissions Warranty Coverage

OPERATION DESCRIPTION

TIME

982010A Install One (1), Two (2), Or 0.3 Hr.

Four (4) Worm Clamps

DEALER CODING

CONDITION

BASIC PART NO.

CODE

33

5E258

OASIS CODES: 403000, 702000, 702100, 702200,

703000

Article No. 98-20-10 Cont'd.

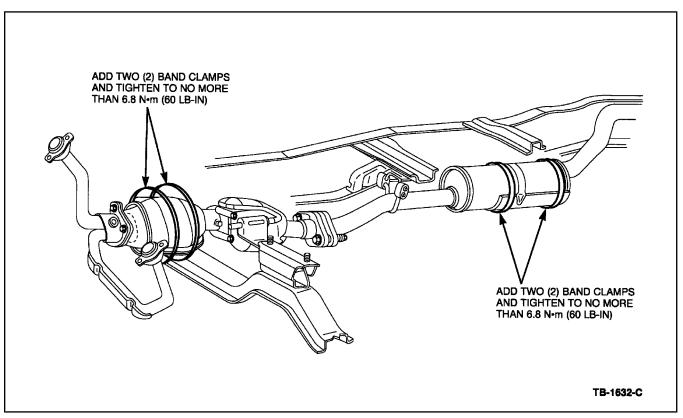


Figure 1 - Article 98-20-10

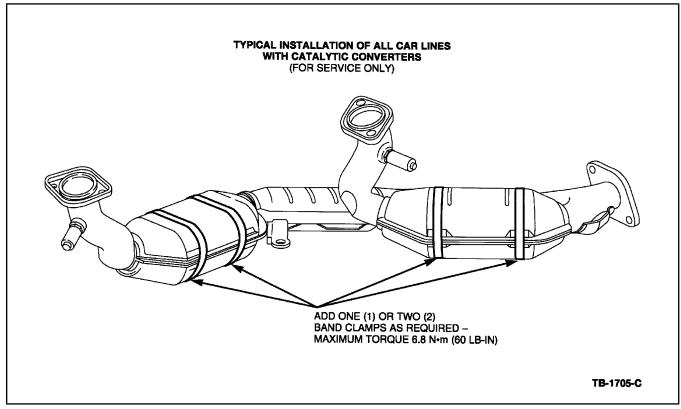


Figure 2 - Article 98-20-10