### CQIS Reports for Inquiry RQ04-007

Inquiry: RQ04	4-007		Repor	No: 3FXLX002	Report D	<b>)ate:</b> 6/24	/2003	Source: CQIS
Model Year:	2003		Mode	I: CRNVIC	VIN: 2F	AHP71W53	X175804	PGM Type:
Symptoms:	3 06	2	00	CHASS. AIR LOSS		TIRES/WHI	EELS	
Addl. Sympto	m:					Odometer:	11000	м
Engine: 4.6L	ROM B	٦	Fransmis	sion: 4R70W	Build Date:	1/2/2003	Warran	ty Start: 1/21/2003
Dealer: A0F0	1 FLEI	ET & C	BOVT. (N	IONG FCSD Reg	jion:	City: All	len Park	State: MI
Customer First	st Name	: CIT	Y OF BE	CKER Last Nam	POLICE DEPA	City:		State:
Causal Comp	onent:	015	WH	EEL ASSY				Photo: 21

#### Comment Type: Comments:

CONCER DRIVER LOST CONTROL OF VEHICLE AND HAD A SINGLE CAR ACCIDENT REPAIR POLICE OFFICER WAS ATTEMPTING TO CATCH UP WITH A SUSPECT VEHICLE AND W REPAIR AS TRAVELING AT 80 TO 100 MILES PER HOUR WHEN VEHICLE SHOOK AND THEN T REPAIR HE REAR OF VEHICLE SWUNG TO THE RIGHT. UNIT ENDED UP IN THE MEDIAN WHE REPAIR RE IT ROLLED ABOUT 3 TIMES. FQE REVIEWED UNIT ON 6/24 AND FOUND THAT T REPAIR HE RIGHT REAR TIRE TREAD HAD SEPARATED FROM THE SIDEWALL. THERE WAS GR REPAIR OUND UP RUBBER INSIDE THE TIRE WHICH MIGHT INDICATE THAT THE TIRE HAD REPAIR BEEN RUN WHILE VERY LOW ON AIR OR FLAT. THE LEFT REAR TIRE WAS THE ONL REPAIR Y ONE THAT STILL HAD AIR IN IT AND IT HAD 39.5 PSI IN IT ON AN 83 DEGR REPAIR EE DAY. COULD NOT SEE ANY SIGNS OF PUNCTURES IN THE PARTOF THE TIRE TH REPAIR AT WAS LEFT. FQE WILL HOLD TIRE AND WHEEL FOR REVIEW. TOM HECKER SEE A REPAIR TTACHED PICTURES. FQE MINNESTOA (952) 906-2990

#### Taylor, Alma (A.)

From: Sent: To: Cc: Subject: Lovelace, Maria (M.E.) Wednesday, June 25, 2003 8:10 AM Taylor, Alma (A.) George, Tim (J.) FW: RE: Fleet Inspection Request

-----Original Message

From:	Hecker, Thomas (T.P.)
Sent:	Tuesday, June 24, 2003 9:24 PM
To:	Lovelace, Maria (M.E.); Bersuder, Lee (L.C.)
Subject:	RE: RE: Fleet Inspection Request

I reviewed the vehicle today at Al's towing in Clear Lake, Minnesota. The tire tread had separated from both sidewalls and I picked it up at the Becker police station. The inside of the tread portion of the tire had a large amount of rubber particles on it which might indicate that tire had been run with very low or no air pressure. I could not see any punctures or cuts in the tread area or in either of the sidewalls. The wheel with both of the side walls still on it was on the vehicle. The tech removed the wheel and I have it. The tire that went flat was the right rear. The police chief indicated to me that this vehicle had a flat tire about 3 weeks ago on the front right. I inspected that tire and there was a cut near the bead that went through the tire. I also have that wheel in my possession. (I did not take the tire.) Examination of the wheels showed a couple of areas of the weld that had a small amount of paint gone, but no obvious leak areas.

Both of the rear tires were Goodyear Eagle Ultragrip M+S P225/60R16. These tires had been installed for the winter and were being left on the vehicle to be "run out" through the summer. The left rear tire was the only tire on the vehicle that still had air in it. I checked the pressure in it and it was 39.5 psi and the temp was 83 degrees F. Both wheels have the following Dot info on them. 16X7 J T DOT K4 1 120402 3.18

This police department is in a small city and has two 2001 Crown Vics and one 2003 Crown Vic. The police officers are responsible for the maintenance on their units including checking tire pressure.

The driver of the vehicle is the K9 police officer and was attempting to "catch up" with a suspect vehicle when the accident happened. The officer has stated that he was driving between 80 and 100 mph when he felt a vibration. The rear end of the vehicle swung to the right and propelled him into the median area while rotating counter clockwise. Once the vehicle entered the median it rolled. The estimate by the driver and the police chief was that it rolled three times. The police officer had to be cut out of the unit. The K9 officer managed to get out on his own. Both of the front air bags deployed and the side bag on the driver's side deployed.

I am attaching pictures to this note and will send another note with the rest of the pictures so I do not overload the system. I will hold onto the two wheels and the one tire until I receive direction relative to where they should be sent.











3fxbx002d.jpg







3fxbx002f.jpg



3fxlx002a.jpg

3fxlx002b.jpg

3fxbx002c.jpg



3fxtx002e.jpg

3fxtx002g.jpg

PES 3fxIx002h.jpg

JPEC. 3fxix002i.jpg



-----Original Message

## MORS III Reports for Inquiry RQ04-007

Inquiry: RQ04-007	:	Source: MORS I	II
Region: 58 TWIN CITIES Issue: LEGAL	Zone: A2	Case: 29752	21743
VIN: 2FAHP71W53X175804 Engine: W	Veh Type: C C	pened: 3/27/2	004
	ſ	Closed: 4/2/	2004
Last Name CITY OF BEC Title: First Name:		Status: CLOSE	:D
Address 12060 SHERBURNE AVE City: BECKER	२ State	MN ZIP:	55308
Phone: 763-2614449			
Model Year: 2003 Model: CROWN VICTORIA	P 4-D Milea	ge: 11164 I	Build_Date:
Dealer Name: MONTICELLO FORD-ME Sales Code: F	58643 P and	A: 09354	
Reason Code: 0772 LEGAL - ACCIDENT			
Symptoms: 306300 TIRES/WHEELS REMOVAL OF			
Origin: CALGF CONSUMER AFFAIRS - LITIGATION PRI	EVENTION- FAX	3/27/200	4 4:03:14 PM
Action: LP203 OPEN LEGAL CONTACT - ATTORNEY D	EMAND	02975	5217430772 30630007
NAME OF LAW FIRM ROBINS, KAPLIN, M			
ATTORNEY NAME BRUCE D. MANNING	j.		
ATTORNEY PHONE NUMBER 6123498500			
**************************************	***		
FAX RECEIVED 3-26-04. ATTORNEY ALLEGES HIS CLI	-		
E (POLICE CRUISER) STARTING SHAKING WHEN THE	/EHICLE REACHED		
SPEEDS NEAR 100 MPH. THE REAR TIRE DEFLATED (	CAUSING THE OP		
ERATOR TO LOSE CONTROL OF THE VEHICLE AND RO	LLED THE VEHICLE		
SEVERAL TIMES. ATTORNEY DEMANDS CONTACT FRO	OM FORD REPRES	INT	
ATIVE.			
Origin: CALGL CONSUMER AFFAIRS - LITIGATION PRI	EVENTION FAX	3/29/200	4 12:05:12 PM
Action: LP304 SEND ACKNOWLEDGEMENT LETTER T			5217430772 30630007
ATTORNEY ACKNOWLEDGEM	ENT LETTER		
LPA SENT ACKNOWLEDGEMENT TO ATTORNEY.			

 Origin: CALGL CONSUMER AFFAIRS - LITIGATION PREVENTION FAX
 4/2/2004
 1:21:21 PM

 Action: LP613
 DENY ASSISTANCE - REFER TO INSURANCE CARRIER
 02975217430772 30630007

 THE INSURANCE COMPANY HAS ALREADY BEEN INVOLVED. NO FURTHER
 ACTION IS NEEDED.

## MORS III Reports for Inquiry RQ04-007

٠

inquiry: RQ04-007			Source:	MORS III
Region:	Issue: CONCERN	Zone:	Case:	297521743
VIN: 2FAHP71W53X175804	Engine: W	Veh Type:	C Opened:	6/23/2003
			Closed:	8/12/2003
Last Name CITY OF BEC	Title: First Name:		Status:	CLOSED
Address 12060 SHERBURNE	EAVE City: BECKE	R	State MN	ZIP: 55308
Phone: 763-2614449				
Model Year: 2003	Model: CROWN VICTORIA	<b>A</b> P 4-D	Mileage:	11000 Build_Date:
Dealer Name:	Sales Code:		P and A:	
Reason Code: 4101 ICCD	- RESOLUTION REQUIRED	)		
Symptoms: 306700 TIRE	S/WHEELS APPEARANCE			
Origin: NAFS NORTH AM Action: DAC057 DOCUMEN **CVO ANALYST WILL REQU	T ADDDITIONAL INFORMAT		PHONE	6/23/2003 8:17:42 AM 02975217434101 30670003

Action: NAF129 OP **CVO ANALYST RE IED ADJUSTER, PH ICATED THAT WHIL ON, THEN THE TIRE DATE 6-18-03. THE SOFT TISSUE. MR. HE MENTIONED TI	RTH AMERICAN FLEET SERVICE EN NAFS CONTACT-PRODUCT LIABILITY CEIVED A PHONE CALL FROM MARK STAI 612 766-3714, 612 849-2313 (CELL). HE IN E THE OFFICER WAS DRIVING, HE FELT A BLEW. THIS VEHICLE ROLLED OVER. IN OFFICER SUSTAINED NON-SERIOUS INJU STANGER IS SEEKING AN INVESTIATION HE POSSIBILITY OF THIS ISSUE BEING RE L CONCERN. VEHICLE LOCATION AL TOW	NGLER @ ALL D VIBRATI ICIDENT URIES, BY FMC. LATED T	8:15:52 AM /434101 30670003
Action: NAF137 INF **CVO ANALYST RE	RTH AMERICAN FLEET SERVICE O RECEIVED FROM ENGINEERING CEIVED FQE INSPECTION REPORT. THE /ITH SCOTT CLARK, MOD.		 2:59:55 PM /434101 30670003

\_\_\_\_\_

L.


Inquiry: RQ04-007			Source	: MORS III
Region:	Issue: CONCERN	Zone:	Case:	297521743
VIN: 2FAHP71W53X175804	Engine: W	Veh Type: 🔇	Opened:	6/23/2003
			Closed:	8/12/2003
Origin: NAFS NORTH AME	RICAN FLEET SERVICE		OTHER	8/12/2003 9:46:19 AM
Action: NAF131 CLOSE LEG	AL CONTACT			02975217434101 3067000
**CVO ANALYST RECEIVED	FQE VEHICLE INSPECT	ON REPORT, 6-25	5-03	
. ADDITIONAL WHEEL INSPI	ECTION REPORT RECE	IVED FROM K. CH	IRIS	
TENSON, CCR MGR. (8-12-03	). THE REPORTS WER	E REVIEWED WIT	гн	
S. CLARK, MOD. IT WAS DE	TERMINED THAT FMC V	VOULD DENY AS	SIST	
ANCE. THE DENIAL DECISIO	ON INFORMATION WAS	PROVIDED, VIA F	Ю	
NE, TO MARK STANGLER, A	LLIED ADJUSTERS, PH:	612 766-3714. A		
DENIAL LETTER WAS SENT	TO BECKER CITY PD,	CHIEF KEVIN RIEL	LA	
ND, VIA US MAIL.				

J

.


.



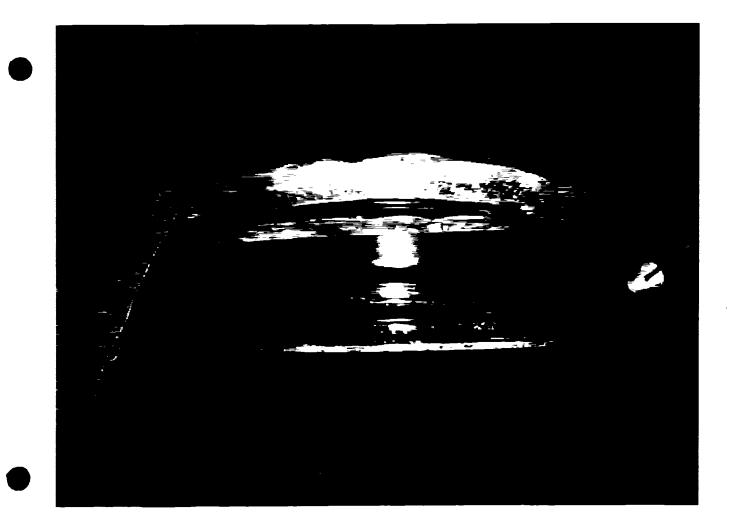

-

http://www.gcqis.ford.com/gcqis/asp/Di\_Retrieve\_attach.asp?AttachmentID=274585 9/15/2004

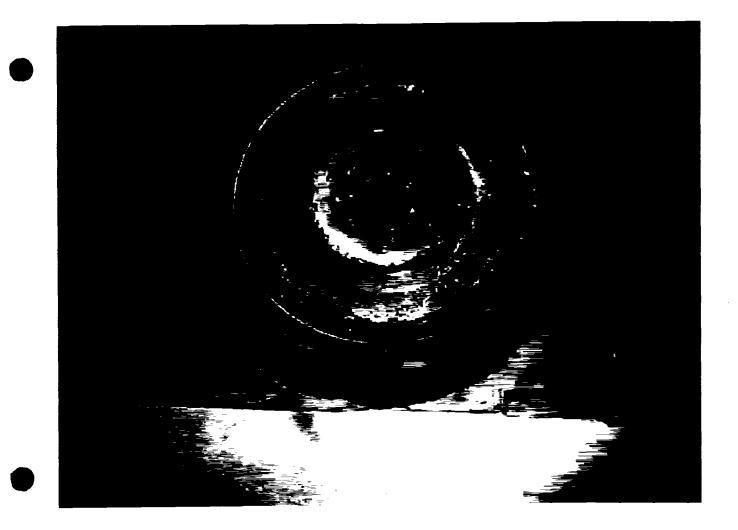







#### CQIS Reports for Inquiry RQ04-007

Inquiry: RQ04-007	Report No: 3.	INK2001 Repo	t Date: 10/14/2003	Source: CQIS
Model Year: 2003	Model: CRNV	IC VIN:	2FAFP71W43X129338	PGM Type:
Symptoms: 3 06	0 00 CHA	SS.	TIRES/WHEELS	
Addl. Symptom:			Odometer: 11365	Μ
Engine: 4.6L ROM B	Transmission: 4	R70W S Build Date:	6/26/2002 Warrar	nty Start: 8/1/2002
Dealer: 04982 Gatew	ay Ford, Inc.	FCSD Region:	City: Kissimmee	State: FL
Customer First Name:		Last Name	City:	State:
Causal Component: Til	RE TIRE			Photo: 0

Comment Type: Comments:

CONCER FQE VEHICLE INSPECTION REQUEST

REPAIR I INSPECTED THE 2003 FORD CROWN VICTORIA POLICE VEHICLE AT GATEWAY FOR REPAIR D IN KISSIMMEE, FLORIDA ON OCTOBER 13, 2003 FOR AN ALLEGED TIRE BLOW O REPAIR UT. THIS VEHICLE IS A LOCAL LAW ENFORCEMENT VEHICLE THAT IS PERFORMING REPAIR NORMAL DUTIES. ACCORDING TO THE INFORMATION RECEIVED, THE DRIVER OF REPAIR THE VEHICLE STATED THAT THE VEHICLE'S TIRE BLEW AND THE VEHICLE HIT A REPAIR CURB AND BELIEVES THAT THE INCIDENT IS RELATED TO 03S05.' LOOKING AT T REPAIR HE VEHICLE I FOUND THAT THE RIGHT FRONT WHEEL WAS MISSING, BUT THERE A REPAIR PPEARED TO BE NO OUTER BODY DAMAGE. I SHOULD NOTE THAT THE RIGHT REAR REPAIR TIRE AND RIM WERE BRAND NEW. BEFORE THIS INSPECTION WAS PERFORMED, THE REPAIR VEHICLE AND BROKE THEM DOWN. THE RIGHT SIDE TIRES AND RIMS OFF OF THE REPAIR VEHICLE AND BROKE THEM DOWN. THE TWO RIMS IN QUESTION HAD DATE CODES REPAIR OF K402 6 21 AND K402 12 4. THE FIRST

ADD-ON RIM DATE CODE FALLS INTO THE DATE RANGE THAT 03S05 CALL OUT FOR THAT R ADD-ON IM TO BE REPLACED. THE SECOND RIM DOES NOT FALL WITHIN THE REPLACEMENT ADD-ON DATE RANGE, BUT DOES FALL UNDER 03M03 THE CUSTOMER SATISFACTION PROGR ADD-ON AM. ALTHOUGH NEITHER LOOKED TO HAVE SEAM CRACKS THEY DO FALL WITHIN TH ADD-ON E DATES TO BE REPLACED. I LOOKED UP TO SEE IF THE DEALERSHIP HAD REPLA ADD-ON CED THE RIMS BEFORE THE INCIDENT AND THEY HAD NOT. THERE IS A CLAIM ON ADD-ON 9-29-03 FOR FOUR RIMS UNDER THE 03S05, BUT THE 9-29-03 CLAIMS WOULD H ADD-ON AVE BEEN AFTER THIS INCIDENT ON 9-22-03.IT APPEARS THAT ONE OF THE FOU ADD-ON R TIRES HAS BEEN REPLACED BECAUSE THE DOT IS DIFFERENT THAN THE OTHERS ADD-ON . THE NEWER TIRE HAPPENS TO BE ON THE RIGHT FRONT. JUST LOOKING AT THA ADD-ON T TIRE, I WOULD HAVE SAY THAT IT WAS STRUCK BY SOMETHING AND THAT IS W ADD-ON HAT CAUSED THE INCIDENT. THIS TIRE HAS A LARGE HOLE IN THE SIDEWALL WI ADD-ON TH RUB MARKS JUST BEFORE THE HOLE AND WAS ON THE INSIDE OF THE TIRE. T ADD-ON HE DAMAGE TO THE RIMS WAS ON THE OUTER SIDE AND WAS CAUSED BY HITTING ADD-ON THE CURB. THE REAL QUESTION IS DID THIS TIRE DAMAGE HAPPEN BEFORE OR W ADD-ON AS IT THE RESULT OF THE INCIDENT? I CANNOT SAY FOR SURE, BUT THERE IS ADD-ON NO CLEAR EVIDENCE THAT THIS INCIDENT HAPPEN BECAUSE OF THE 03S05 SAFET ADD-ON Y RECALL OTHER THAN THE RIMS MEETING THE DATA CODES. PLEASE FEEL FREE ADD-ON TO CONTACT ME WITH ANY QUESTIONS. DONALD CHRISTOFF FIELD QUALITY ENGIN ADD-ON EER - ORLANDO PH# 321-662-7362

# MORS III Reports for Inquiry RQ04-007

.

Inquiry: RQ04-007			Source:	MORS III	
Region:	Issue: CONCERN	Zone:	Case:	1372172	753
VIN: 2FAFP71W43X129338	Engine: W	Veh Type: C	Opened:	10/2/200	03
			Closed:	11/25/20	003
Last Name CITY OF KISSI	Title: First Name	:	Status	CLOSED	
Address 100 N ALASKA AVE	City: KISS	IMMEE SI	ate FL	<b>ZIP:</b> 3	4741
Phone: 407-8472821					
Model Year: 2003	Model: CROWN VICTOR	RIA P 4-D M	ileage:	8459 Bu	ild_Date:
Dealer Name:	Sales Code	. Р	and A:		
Reason Code: 4101 ICCD	- RESOLUTION REQUIRE	ED			
Symptoms: 306705 TIRE	S/WHEELS APPEARANCE	E DAMAGED			
Origin: NAFS NORTH AM	ERICAN FLEET SERVICE	РН	ONE	10/2/2003	10:27:40 AM
Action: DAC057 DOCUMEN				1372172	27534101 30670503
**CVO ANALYST CONFIRME					
@ GATEWAY FORD AND DA O WILL REQUEST A VEHICL	•	T OF NISSIMMEE	υv.		

Origin: NAFS NORTH AMERICAN FLEET S		OTHER		10:20:16 AM
Action: NAF129 OPEN NAFS CONTACT-PRO **CVO ANALYST RECEIVED ISSUE INFORMA		LINE ANALYS	13721727	7534101 30670503
T. ACCORDING TO THE INFORMATION RECI RE BLEW AND THE VEHICLE HIT A CURB. B	OTH THE RIGHT	FRONT AN		
D REAR TIRES BLEW. THE CUSTOMER BELI LATED TO RECALL 03S05. INCIDENT DATE: . FLEET CONTACT: DARRELL DARULLA, CIT 7 518-2508. VEHICLE LOCATED AT GATEWA DULGAR, PH: 407 846-6000.	9-22-03. NO INJU Y OF KISSAMME	JRIES E, PH: 40		
Origin: NAFS NORTH AMERICAN FLEET S Action: DAC057 DOCUMENT ADDDITIONAL II	ERVICE		10/15/2003	
**CVO ANALYST RECEIVED THE FQE INSPEC AIR EST FROM JERRY DULGAR @ GATEWAY				
AN OFFER LETTER AND RELEASE TO DARR		OITV OF VIC		

Monday, September 13, 2004 Repeated Report (Y/N):

Inquiry: RQ04-007		_			MORS III		
Region:	Issue: CONCERN	Zone:		Case:			
VIN: 2FAFP71W43X129338	Engine: W	Veh Type:	С	Opened:			
				Closed:			
Drigin: NAFS NORTH AME Action: DAC057 DOCUMENT **THE CITY OF KISSIMMEE F R AND RELEASECVO AN. ORTON, OGC. OGC WOULD VE THE RELEASE CONSTRL RIDACVO ANALYST LEFT ATTY., REQUESTING A RETU	ADDDITIONAL INFORMA REQUESTED CHANGES 1 ALYST FORWARDED THI NOT AGREE TO CHANG JED AND INTERPETED U T A MESSAGE FOR DON 3	TO THE OFFER E REQUESTS E THE WORDI NDER THE LAN	R LET TO S. NG T W OF	TE N O HA FLO	0/24/2003 1372172	1:40:48 PM 7534101 30670503	
Drigin: NAFS NORTH AME Action: DAC057 DOCUMENT **CVO ANALYST SENT REVI: , TO DARRELL DARULLA @ (	ADDDITIONAL INFORMA		FAX		0/28/2003 1372172	9:58:59 AM 7534101 30670503	
Drigin: NAFS NORTH AME Action: DAC057 DOCUMENT **CVO ANALYST RECEIVED ROM JIM EMERY @ CITY OF HE AUTHORIZATION FOR RE AN APPROVAL CODE WILL I LETED.	ADDDITIONAL INFORMA THE SIGNED OFFER LET KISSIMMEECVO ANA EPAIRS TO JERRY DULG	TER AND REL LYST PROVID AR @ GATEW/	ED T AY FC	F DRD.	0/30/2003 1372172	2:54:37 PM 7534101 30670503	
Drigin: NAFS NORTH AME Action: NAF204 AWA W04 R **CVO ANALYST PROVIDED OVAL CODE, THE REPAIR CH	BILL BAILEY @ DLR WITH		PHC		1/25/2003 13721727	2:46:27 PM /534101 30670503	
Drigin: NAFS NORTH AME Action: NAF213 AWA W04 RI **CVO ANALYST PROVIDED ER GOODWILL REPAIRS REI	EQUEST - APPROVED THE DLR WITH THE APP!	ROVAL CODE	TO C			2:31:11 PM /534101 30670503	

,





# 

.













